

J/88
QUANTUM QUICK TUNE

The state of the s												
TWS Knots	Uppers Turns from base	Uppers Tensions PT-2	D2 Turns from base	D2 Tensions PT-2	Lowers Turns from base	Tensions PT-2 Tensions PT-2	Jib / A sail	Jib Inhaul Weather Jib Sheet on	Traveler Upwind	Vang color Upwind	Backstay Upwind	Jib Furl Downwind
4 to 8	-4		-3		-1.5		AP/ A2	3	+16			In
8 to 12	-2		-1		-0.5		AP / A2	3	+8			In
12 to 16	0	39	0	16	0	22	AP / A2	4	+6			In
16 to 20	2		1		0.5		AP/ A2	3	Center			In
20 to 24	4		2		1.5		Hvy / A2	2	Center / vang			Out / bow up
24+	6		4		3		Hvy / A3	1	Center / vang			Out / bow up
All turns from Base	Setting of 12 to 16											
BASE	SETTINGS											
Caliper #'s	Uppers	D2	Lowers	Headstay								
Port	mm	mm	mm	mm								
Starboard	mm	mm	mm	mm								
.oos PT-2 #	39	16	22	mm								
*Use Calipers to me	easure distance hetw	veen turnbuckles o	nce rig is set up at	base for repeatability	y. Record here on this	chart.						
	USUIC UISTUINCE DETVI											
	off lower spreader	.800m Off top	spreader .55 (n	neasured from cer								
leadstay ARC 1	off lower spreader .682m (measure	.800m Off top from top of white	spreader .55 (ne band at goose	eneck swung out to	o mark headstay to	Tack shackle pin	on furler					
leadstay ARC 1. or backstay mai	off lower spreader .682m (measure rk first 2:1 on bac	.800m Off top from top of white kstay adjuster w	spreader .55 (n e band at goose vith Hand stitche	eneck swung out to ed calibration lines	o mark headstay to	Tack shackle pin	on furler					
leadstay ARC 1 or backstay mai or Vang color ma	off lower spreader .682m (measure rk first 2:1 on bac rk the Hall vang wit	.800m Off top from top of white kstay adjuster w th different color	spreader .55 (ne band at goose vith Hand stitcherings used to giv	eneck swung out to ed calibration lines e the tension of the	o mark headstay to	Tack shackle pin	on furler					
leadstay ARC 1 or backstay mai or Vang color ma	off lower spreader .682m (measure rk first 2:1 on bac	.800m Off top from top of white kstay adjuster w th different color	spreader .55 (ne band at goose vith Hand stitcherings used to giv	eneck swung out to ed calibration lines e the tension of the	o mark headstay to	Tack shackle pin	on furler					

## Jib Inhaul Locations



Vang Tension Marks



Headstay Length Measuring point

